

PROGRESSIVE

1101 OPAL COURT SUITE 305, HAGERSTOWN, MD 21740

*Claim Number: 14-4100584-01

Mitchell Service: 910714

Description: 2006 Volkswagen GTI (2006.5)
 Body Style: 2D HB
 VIN: WVWEV71K46W095538
 Mileage: 141,513
 OEM/ALT: A
 Color: WHITE
 Options: PASSENGER AIRBAG, DRIVER AIRBAG, POWER LOCK, POWER WINDOW, REAR WINDOW DEFOGGER
 MANUAL AIR CONDITION, CRUISE CONTROL, TILT STEERING COLUMN
 TELESCOPIC STEERING COLUMN, ANTI-LOCK BRAKE SYS., TRACTION CONTROL, FOG LIGHTS
 ALUM/ALLOY WHEELS, HIGH INTENSITY DISCHARGE HEADLIGHTS, LEATHER STEERING WHEEL
 FRONT AIR DAM, TINTED GLASS, TRIP COMPUTER, VARIABLE ASSISTED STEERING
 SIDE AIRBAGS, ANTI-THEFT SYSTEM, SIDE HEAD CURTAIN AIRBAGS
 DAYTIME RUNNING LIGHTS, AM/FM STEREO CD CHANGER/MP3 PLAYER
 ELECTRONIC STABILITY CONTROL, FRONT BUCKET SEATS, INTERIOR AIR FILTER
 KEYLESS ENTRY SYSTEM, POWER DISC BRAKES, POWER HEATED EXTERIOR MIRRORS
 POWER LIFTGATE/TRUNK, REAR SPOILER, REAR WINDOW DIVERSITY ANTENNA
 STEERING WHEEL AUDIO CONTROLS

Drive Train: 2.0L Turbo Inj 4 Cyl 6M FWD
 License: 8AK4324 MD
 Search Code: CENTRAL1

Line Item	Entry Number	Labor Type	Operation	Line Item Description	Part Type/ Part Number	Dollar Amount	Labor Units
<u>Front Bumper</u>							
1	001692	BDY	OVERHAUL	Frt Bumper Cover Assy			2.6 #
2	001704	BDY	REMOVE/REPLACE	Frt Add w/Fog Lamps			0.4
3	001705	BDY	REMOVE/REPLACE	Frt Add w/Headlamp Washers			0.4
4	000001	BDY	REMOVE/REPLACE	Frt Bumper Cover	** Non-OEM CAPA	294.00	INC #
5		REF	REFINISH	Frt Bumper Cover			C 2.3
6	000004	BDY	REMOVE/REPLACE	Frt Ctr Bumper Cover Grille	** Non-OEM	35.00	INC
7	000005	BDY	REMOVE/REPLACE	R Frt Bumper Side Cover	1K0 854 662 F 9B9	94.85	INC
8	000006	BDY	REMOVE/INSTALL	L Frt Bumper Side Cover	Existing		INC r
9	000010	BDY	REMOVE/REPLACE	Frt Bumper Spoiler	** Non-OEM	72.00	INC
10	000011	BDY	REMOVE/REPLACE	Frt Bumper Retainer	1K0 805 915 D 9B9	54.06	INC
11	000017	BDY	REMOVE/REPLACE	Frt Bumper Impact Absorber	1K6 807 248	68.90	INC
<u>Grille</u>							
12	000020	BDY	REMOVE/REPLACE	Grille	1K0 853 651 H VW8	192.55	0.2
<u>Front Lamps</u>							
13	001711	BDY	CHECK/ADJUST	Headlamps			0.4
14	000159	BDY	REMOVE/REPLACE	R Front Combination Lamp Assembly	** Non-OEM	425.00	INC #
15	000160	BDY	REMOVE/REPLACE	L Front Combination Lamp Assembly	** Non-OEM	425.00	INC #
16	000185	BDY	REMOVE/INSTALL	R Front Combination Lamp Control Module	Existing		INC #r
17		BDY	REMOVE/INSTALL	R Frt Combination Lamp			INC #
18	000186	BDY	REMOVE/INSTALL	L Front Combination Lamp Control Module	Existing		INC #r
19		BDY	REMOVE/INSTALL	L Frt Combination Lamp			INC #
20	000025	BDY	REMOVE/INSTALL	L Frt Side Marker Lamp			INC #
21	000026	BDY	REMOVE/REPLACE	R Front Side Marker Lamp Assembly	3C0 945 292	55.88	INC #
22	000030	BDY	REMOVE/INSTALL	R Frt Fog Lamp			INC #

ESTIMATE RECALL NUMBER: 01/07/2014 15:21:22 14-4100584-01

Mitchell Data Version: OEM: DEC_13_V0106

MAPP:DEC_13_V0105

Copyright (C) 1994 - 2013 Mitchell International
 All Rights Reserved

Software Version: 7.0.487

Page 1 of 5

Date: 1/ 7/2014 03:35 PM
 Estimate ID: 14-4100584-01
 Estimate Version: 0
 Committed
 Profile ID: HGFRD all part types

23	000031	BDY	REMOVE/INSTALL	L Frt Fog Lamp				INC #
<u>Cooling</u>								
24	000234	BDY	REMOVE/REPLACE	Cooling Radiator	** Non-OEM	174.00		INC #
25		BDY	REMOVE/INSTALL	Frt Bumper Cover				INC #
26	000244	BDY	REMOVE/REPLACE	R Cooling Fan Motor	ORDER FROM DEALER	277.30		INC #
27	000245	BDY	REMOVE/REPLACE	L Cooling Fan Motor	ORDER FROM DEALER	353.60		INC #
28	000246	MCH	REMOVE/REPLACE	Cooling Water Pump	06F 121 011	126.25	3.4	
<u>A/C /Heater/Ventilation</u>								
29	000356	MCH	REMOVE/REPLACE	A/C Refrigerant Recovery	-M			0.3
30	000357	MCH	REMOVE/REPLACE	Air Cond Condenser Assy	-M	** Non-OEM	159.00	INC #
31		MCH	REMOVE/REPLACE	Evacuate & Recharge A/C	-M			1.4
32	000361	BDY	REMOVE/INSTALL	Air Cond Condenser Grille	Existing			0.1*
33	000362	BDY	REMOVE/REPLACE	Air Cond Clip 8@0.72	3D0 867 646	5.76		
<u>Front Fender</u>								
34	000063	BDY	REPAIR	R Fender Panel	Existing			4.0* #
35		REF	REFINISH	R Fender Outside				C 2.1
36	000064	BDY	REPAIR	L Fender Panel	Existing			4.0* #
37		REF	REFINISH	L Fender Outside				C 1.9
38	000069	BDY	REMOVE/REPLACE	R Fender Front Liner	** Non-OEM	48.00		INC
39				MISSING				
40	000070	BDY	REMOVE/REPLACE	L Fender Front Liner	** Non-OEM	47.00		INC
41				MISSING				
42	000072	BDY	REMOVE/REPLACE	R Fender Rear Liner	** Non-OEM	45.00	0.3 #	
43	000073	BDY	REMOVE/REPLACE	L Fender Rear Liner	** Non-OEM	45.00	0.3 #	
<u>Front Inner Structure</u>								
44	000271	BDY	REMOVE/REPLACE	Front Body Radiator Support (Com)	1K0 805 588 S	290.52	4.5 #	
45		MCH	REMOVE/REPLACE	Add To R&R Mechanical Components	-M			1.1 #
46	000272	BDY	REMOVE/INSTALL	Air Duct	Existing			INC r
<u>Wheel</u>								
47	000416	BDY	REMOVE/REPLACE	Alloy Wheel 2@500.00	** Non-OEM	1,000.00	* 0.6	
48				KLUTCH SL5 SILVER/CHROME LIP 18X9.5				
49				EBAY - A/M ACCESSORY COVERAGE EXHAUSTED				
<u>Turbocharger/Intercooler</u>								
50	000697	MCH	REMOVE/INSTALL	Intercooler Assembly	-M	Existing		INC #r
51	000711	MCH	REMOVE/REPLACE	Frt Turbocharger Pipe	-M	1K0 145 945 A	138.98	1.1
<u>Side Body</u>								
52	001761	BDY	REMOVE/INSTALL	R Rocker Moulding				0.8
53	001762	BDY	REMOVE/INSTALL	L Rocker Moulding				0.8
<u>ADDITIONAL COSTS & MATERIALS</u>								
54	936014		ADD'L COST	FLEX ADDITIVE		5.00	*	
<u>ADDITIONAL OPERATIONS</u>								
55		REF	ADD'L OPR	Clear Coat				1.7
<u>Additional Costs & Materials</u>								
56			ADD'L COST	Paint/Materials		215.80	*	
57			ADD'L COST	Hazardous Waste Disposal		3.00	*	
58	900500	BDY *	REMOVE/REPLACE	A/C LABEL	ORDER FROM DEALER	6.00	* 0.1*	
59	900500	BDY *	REMOVE/REPLACE	CATALYST LABEL	ORDER FROM DEALER	6.00	* 0.1*	
60	900500	BDY *	REMOVE/REPLACE	VACUUM HOSE ROUTING LABEL	ORDER FROM DEALER	6.00	* 0.1*	
61	900500	BDY *	REMOVE/REPLACE	ENG OIL/HIGH VOLT/RAD FAN COMBO LABEL	ORDER FROM DEALER	6.00	* 0.1*	
62	900500	BDY *	REPAIR	RT AND LT INTERCOOLER BRACKETS	Existing			20.0*
63	900500	BDY *	REMOVE/REPLACE	RT FLOOR/ROCKER UNDER COVER	ORDER FROM DEALER	50.00	* 0.5*	
64	900500	BDY *	REMOVE/REPLACE	LT FLOOR/ROCKER UNDER COVER	ORDER FROM DEALER	50.00	* 0.5*	
65	900500	BDY *	ADD'L LABOR OP	TRANSFER HID FOG LAMP MODULES	Existing			1.0*
66				TIME INCLUDES CLEAN/RETAPE				
<u>MANUAL ENTRIES</u>								
67	900500	BDY *	REMOVE/REPLACE	SEAM SEALER (REPLACED PANEL)	** Non-OEM	15.00	* INC*	
68	900500	MCH *	REMOVE/REPLACE	MOUNT & BALANCE WITH STEM VALVE	Sublet	36.00	* 0.0*	
69	900500	MCH *	ALIGN	FRONT WHEEL ALIGNMENT W/ REAR REFERENCE	Sublet	69.95	* 0.0*	
70	900500	BDY *	REMOVE/REPLACE	COOLANT	** Non-OEM	10.00	* 0.0*	
71	900500	BDY *	REMOVE/REPLACE	CAR COVER	** Non-OEM	5.00	* 0.2*	
72	900500	REF *	REFINISH/REPAIR	CORROSION PROTECTION / WELDED PANEL	New			0.3*
73	900500	BDY *	REMOVE/REPLACE	LT H/L PIG TAIL	ORDER FROM DEALER	25.00	* 0.5*	
74	900500	BDY *	REMOVE/REPLACE	LT MARKER LAMP PIG TAIL	ORDER FROM DEALER	15.00	* 0.3*	

ESTIMATE RECALL NUMBER: 01/07/2014 15:21:22 14-4100584-01

Mitchell Data Version: OEM: DEC_13_V0106

MAPP:DEC_13_V0105

Software Version:

7.0.487

Copyright (C) 1994 - 2013 Mitchell International
 All Rights Reserved

Page 2 of 5

ESTIMATE RECALL NUMBER: 01/07/2014 15:21:22 14-4100584-01

Mitchell Data Version: OEM: DEC_13_V0106

Software Version: MAPP:DEC_13_V0105

7.0.487

Copyright (C) 1994 - 2013 Mitchell International
All Rights Reserved